

⑥ Akku mittaritaulun alla

Diode
30MR754

Starter emergency
contactor
Bosch 0332002102


Starter contactor
Bosch 0332002102

Main contactor
Bosch 0332014125

- ① MIL-W-5086-A Type II-6
MIL-W 81044/12-6
Raychem EPD 4742 A-10-0
- ② MIL-W-7078 A Type II-14
Raychem 44A1111-14-9
- ③ MIL-W-5086-A Type II-16
MIL-W-81044/12-16
Raychem 44A0111-16-2
- ④ MIL-W-5086-A Type II-18
MIL-W-81044/12-18
Raychem 44A0111-18-9
- ⑤ 2x MIL-W-7078 A Type II-18
Raychem 44A1111-18-9
- ⑥ Honeywell FEP 031.1010
- ⑦ YE 411216 LV
- ⑧ Käynnistyspistoke 100A

79-01-10
Sib

08-01-80	MH	Syl. lämpöanturin siirto Isyl.-II:yl.120249ok	1	③
07-07-79	MH	Akun siirto mittaritaulun alle 20228ok.		⑥
77-07-70	MH	Etäarok startille 20219 okkeen	1	④
Pvm.	Muut	hyv	Muutos	Lukun Merkki

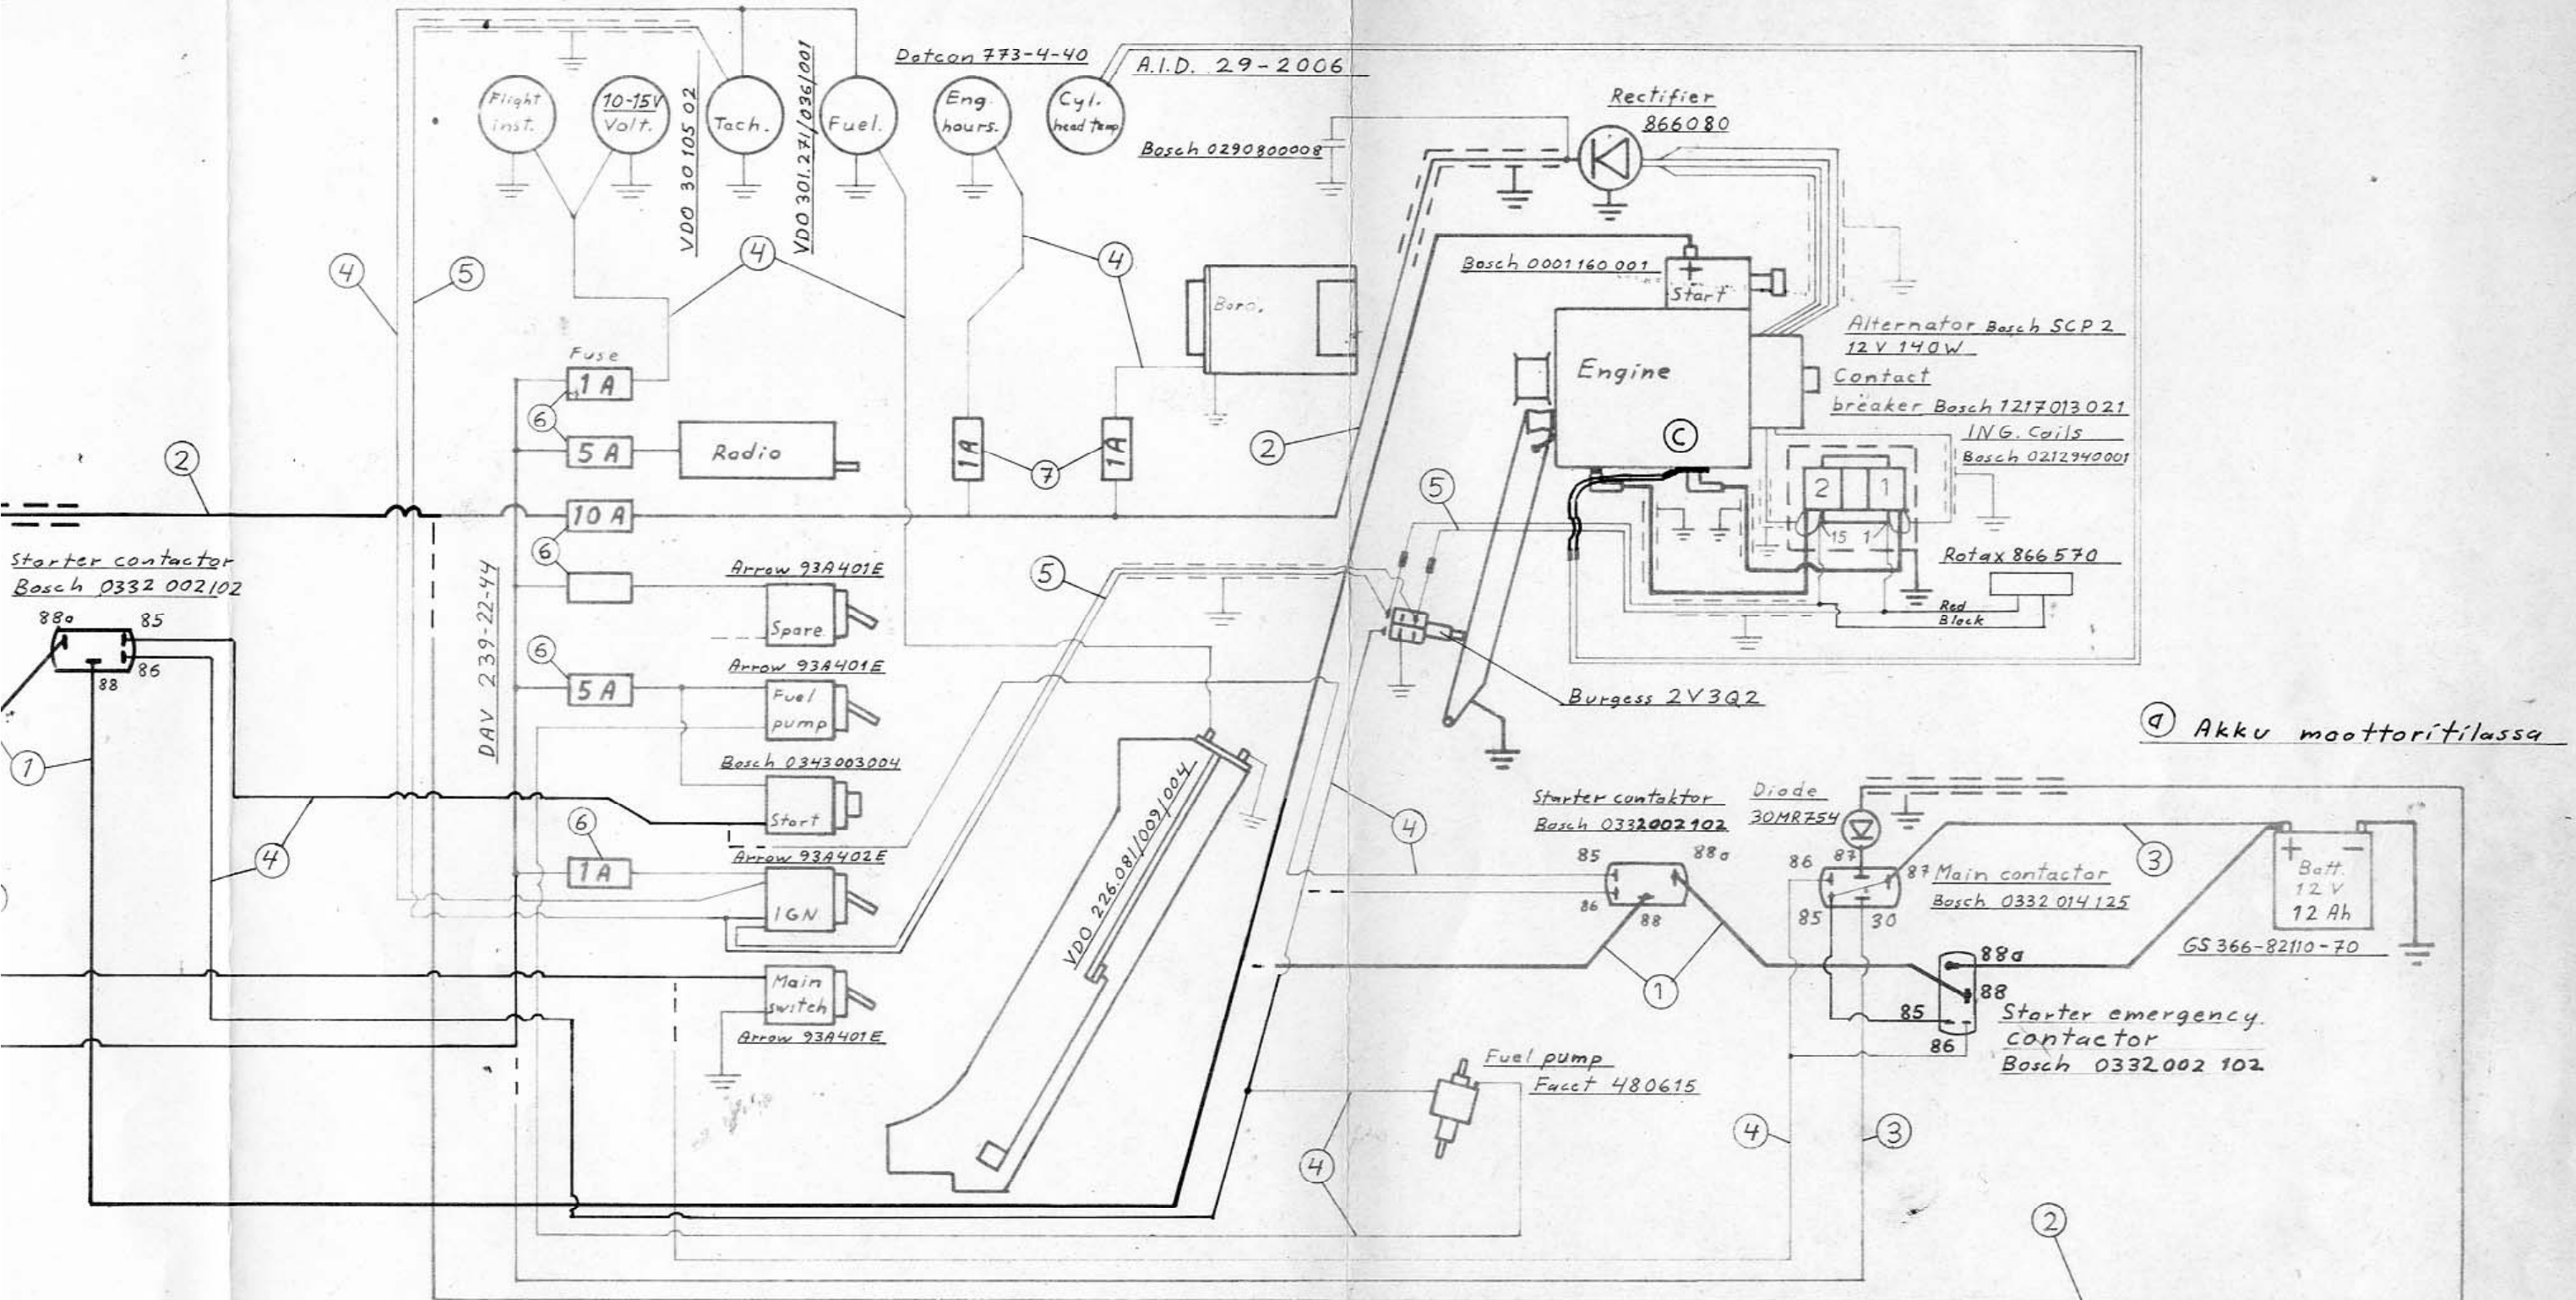

- ① MIL-W-5086-A Type II-6
MIL-W-81044/12-6
Raychem EPD 4742A-10-0
- ② MIL-W-7078 A Type II-14
Raychem 44A1111-14-9
- ③ MIL-W-5086-A Type II-16
MIL-W-81044/12-16
Raychem 44A0111-16-2
- ④ MIL-W-5086-A Type II-18
MIL-W-81044/12-18
Raychem 44A0111-18-9
- ⑤ 2x MIL-W-7078 A Type II-18
Raychem 44A1121-18-9
- ⑥ Honeywell FEP 031.1010
- ⑦ YE 411216LV
- ⑧ Käynnistyspistoke 100A

08-01-80	MH		Syl. lämpömittari siirto Isyl.-Iisyl/20249 alk	1	ⓐ
07-09-79	MH		Akun siirto mittaritaulun olle 20228 alk.		ⓑ
77-07-70	MH	EN	Hätärele startille 20219 alk	1	ⓒ
Pvm.	Muut	hyv	Muutos		Lukun Merkki

Sähköjärjestelmä 3-20E-28-001ⓐ
 1879-1-09 5 Dykter
 ⓑ
 ⓒ